


Infinity Tent Sales

20 x 30 Fast Peak Frame Tent Set Up Instructions



Pipe			
QTY	SIZE	COLOR	Style
1	8'4"		Mast
3	19' 4"	Blue	Spreader
4	14' 4"	Red	Spreader
6	7' 8"	Black	Legs

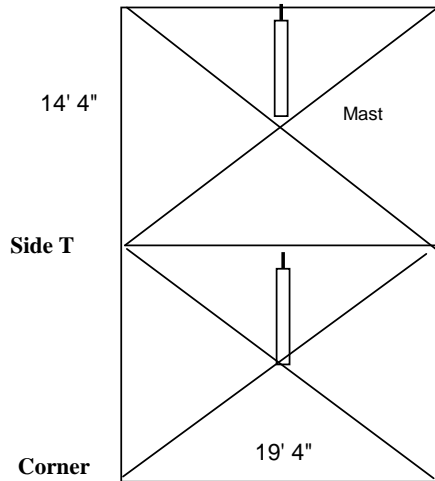

Side T





Corner

Components	
QTY	Style
4	Cross Cables
4	Fast Peak Corners
2	Side T
6	Midspan Tensioners
6	Baseplates
6	Ratchets
20	Tent Pins
Optional Items	
6	Weights / Stakes
1	Brace Package

Pre-Site Inspection- Call your local utility companies prior to installation for any underground obstructions.

1. Layout the frame parts in the estimated location pertaining to the diagram. The spreader pipe is placed out to form the perimeter, and the rafters are laid in the interior location.
2. Connect the perimeter spreader pipe to the corner fittings and side t's.
3. Put the first cable over one of the Side T fittings nubs. Goto the opposite corner & raise the that corner. Then slip the end of the cable over the nub. Repeat for the opposite cables.
4. Place the tent top over the frame.
5. Secure the tent top to the frame by securing the straps on the inside of the tent at each corner location.
6. Raise tent on one of the long sides & insert legs. Take the mast and insert into the top and set on the crosscables. Pin the leg to the fitting. (When raising the tent, raise INTO the wind)
7. Proceed to work your way around the tent putting one leg in at a time until all legs are standing and pinned. Put baseplate under legs and attach 1" ratchets from the "O" rings at the ends of the valance to the baseplates. Tighten loosely.
8. Drive a stake about four feet out from each leg and tie off the rope or ratchet to each leg.

Your tent installation is now complete.

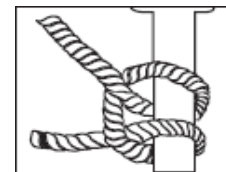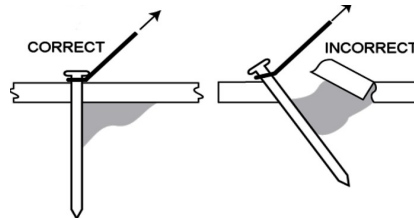

This document was created with Win2PDF available at <http://www.win2pdf.com>.
The unregistered version of Win2PDF is for evaluation or non-commercial use only.
This page will not be added after purchasing Win2PDF.